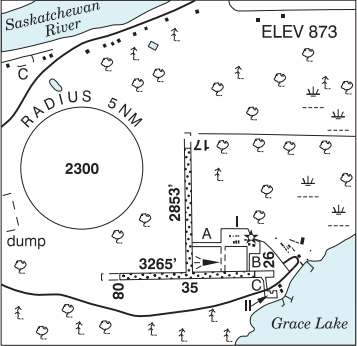


MANITOBA

AERODROME / FACILITY DIRECTORY

THE PAS / GRACE LAKE MB

CJR3

REF	N53 49 35 W101 12 19 Adj E 6°E (2020) UTC-6(5) Elev 873' A5016 LO1 CAP	
OPR	Beaver Air Services LLP 888-668-3822, APM 204-620-0175 Cert	
PF	B-1 C-2,3,4,5,6	
FLT PLN	Pilots to open/close VFR fit plan with Edmonton rdo, FISE or by phone.	
FIC	Edmonton 866-WXBRIEF (Toll free within Canada) or 866-541-4102 (Toll free within Canada & USA)	
SERVICES	APM 204-620-0175	
FUEL	100LL The Pas Flying Club 13-22Z‡ 204-623-7578/6544 O/T 204-623-7578 or 204-620-7105	
OIL	All	
RWY DATA	Rwy 08(083°)/26(263°) 3265x50 GRVL Rwy 08 down 0.35% Rwy 17(173°)/35(353°) 2853x65 GRVL	
RWY CERT	Rwy 08/26 AGN II Rwy 17/35 AGN II	
RCR	APM A/D maint avbl 13-22Z‡ Mon-Fri exc hols O/T 2 hrs PN, call out chg. No win maint Rwy 17/35.	
LIGHTING	08-(TE LO), 26-(TE LO) ARCAL-122.8 type J (see CAUTION)	
COMM		
RCO	Edmonton rdo (The Pas) 123.55 (FISE) 126.7 (bcst) (may not be receivable on the gnd)	
ATF	UNICOM ltd hrs O/T tfc 122.2 5NM 3900 ASL	
NAV		
DME	YQD 113.6 Ch 83 N53 58 25 W101 06 00 (911')	
CAUTION	Extv bird activity during spring (Apr-May) and fall (Sep-Oct) migration. Rwy edge lgt installed higher than std (aprx 27 inches high loc 5' outside rwy edge). Graded Areas: Graded areas around rwy for aprt maint vehicle only.	