
EARLTON (TIMISKAMING REGIONAL) ON CYXR

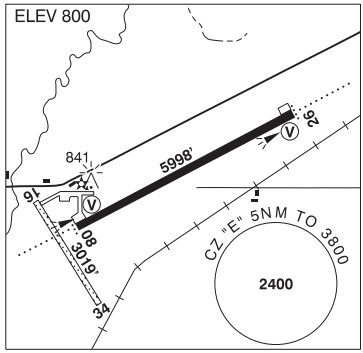

REF	N47 41 42 W79 50 56 1SW 12°W UTC-5(4) Elev 800´ A5001 LO4 LO7 HI4 HI5 CAP
OPR	Earlton-Timiskaming Regional Airport Authority 705-563-2215 Reg 1200-2030Z‡ Mon-Fri exc hols
PF	B-1 C-2,4, D-3,5,6
FLT PLN **FIC** **WX**	 London 866-WXBRIEF (Toll free within Canada) or 866-541-4104 (Toll free within Canada & USA) METAR AUTO H24 (see COMM) TAF 13-01Z‡, issue times: 13, 18Z (DT 12, 18Z). WxCam
SERVICES **FUEL** **OIL**	 100LL, JA-1 1200-2030Z‡ Mon-Fri exc hols, O/T Cardlock (VISA/Mastercard) 100, 15W50
RWY DATA **RCR**	Rwy 08(075°)/26(255°) 5998x150 ASPH AGN IIIA Rwy 16(160°)/34(340°) 3019x150 GRVL Rwy 34 up 0.86% AGN I London FIC AMSCR/CRFI 1100-2030Z‡ Mon-Fri exc hol Nov 7-Apr 17 O/T 3hr PN call out charge may be levied ctc opr. PCN Rwy 16/34 No win maint Soft in spring & fall
LIGHTING	08-AD(TE ME) V2, 16-(TE ME), 26-AD AS(TE ME) V2, 34-(TE ME) ARCAL-122.0 type K. RILS activated by ARCAL on high ints setting only. Rwy16/34 not avbl Nov 7-Apr 16.
COMM **RCO** **MF** **AWOS**	 London rdo 123.375 (FISE) tfc 122.0 5NM 3800 ASL (CAR 602.98) 128.6
PRO	Rgt hand circuits Rwy 08 (CAR 602.96).