OTTAWA/MACDONALD-CARTIER INTL, ON

ILS SA CAT II RWY 07

451921N 0754002W VAR 14°W

CYOW

ATIS – **121.15** (En) **132.95** (Fr)	ARR – **135.15**	TWR – **118.8**	GND – **121.9**

SAFE ALT 100 NM	LOC IOW	APCH CRS	GP AMOBI	LDA
7100	**109.5**	**071°**	**1720**	**8000**

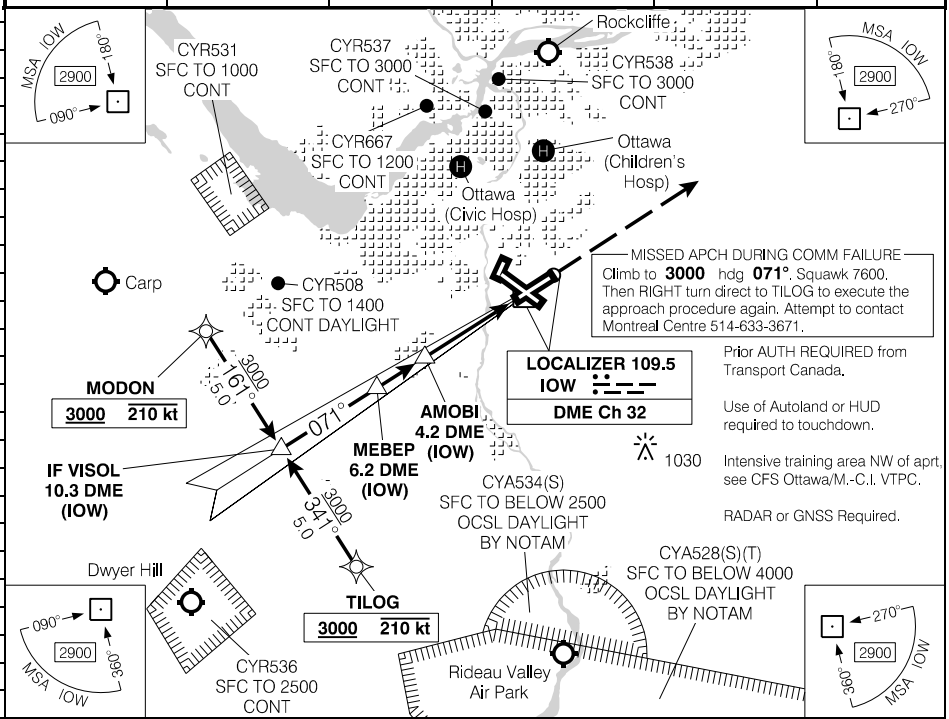

MISSED APCH DURING COMM FAILURE
Climb to **3000** hdg **071°**. Squawk 7600. Then RIGHT turn direct to TILOG to execute the approach procedure again. Attempt to contact Montreal Centre 514-633-3671.

Prior AUTH REQUIRED from Transport Canada.

Use of Autoland or HUD required to touchdown.

Intensive training area NW of aprt, see CFS Ottawa/M.-C.I. VTPC.

RADAR or GNSS Required.

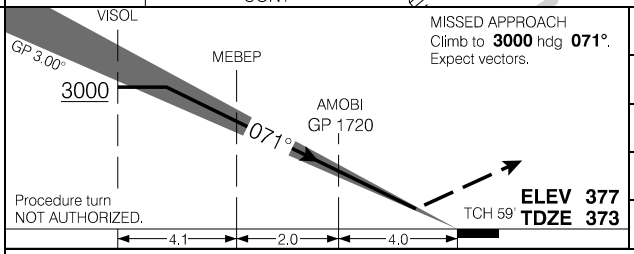

MISSED APPROACH
Climb to **3000** hdg **071°**.
Expect vectors.

PRIOR AUTH REQUIRED FROM TC			
SA CAT II	**473**	(100)	RVR 16

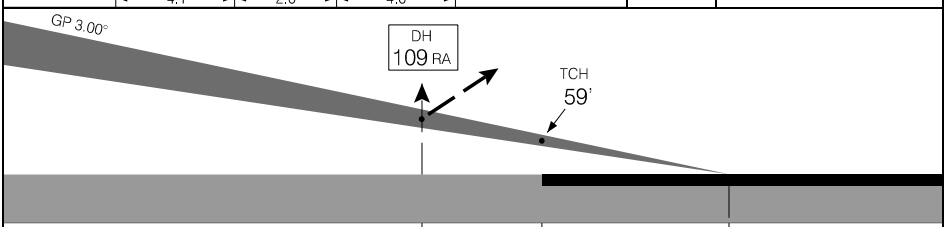

DISTANCE TO THRESHOLD	864 FEET	1126 FEET	6874 REMAINING

Source of Canadian Civil Aeronautical Data: © 2026 NAV CANADA All rights reserved

Canada Air Pilot
Effective 0901Z 3 SEP 2026 to 0901Z 29 OCT 2026