


CANADA FLIGHT SUPPLEMENT / GPH 205

Effective 0901Z 12 August 2021 to 0901Z 7 October 2021

AERODROME/FACILITY DIRECTORY B431

HALIFAX / STANFIELD INTL NS

CYHZ

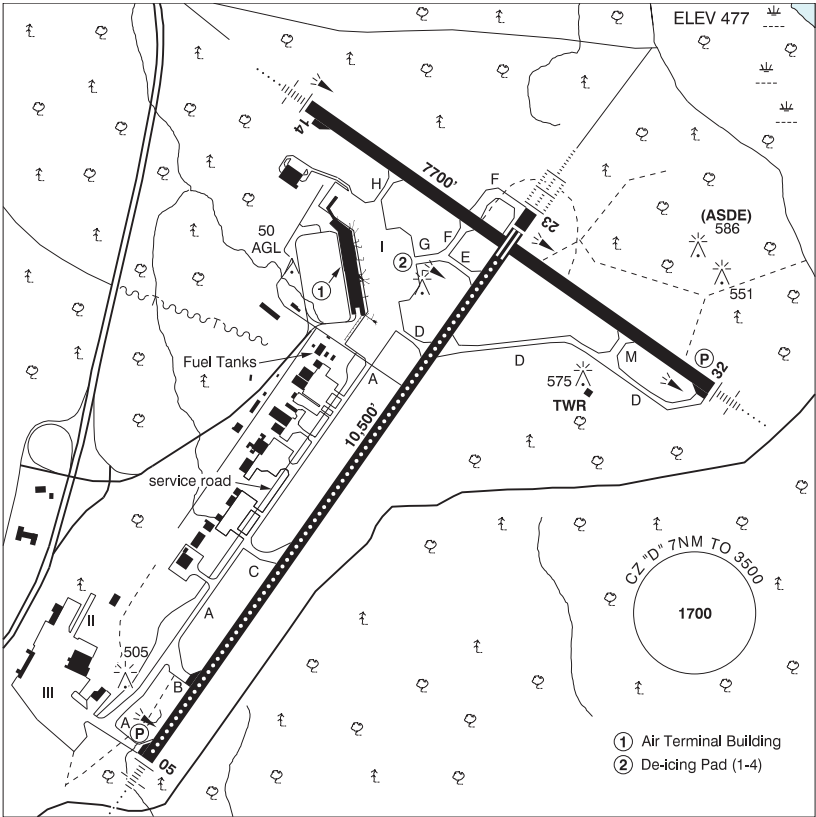

REF	N44 52 47 W63 30 37 14NNE 18°W (2012) UTC-4(3) Elev 477' A5003 LO8 HI6 T2 CAP OC
OPR	Halifax International Airport Authority 902-873-2578 Cert
PF	A-1,2,3,5,6,7
CUST	AOE 888-226-7277
FLT PLN	FIC ACC WX London 866-WXBRIEF (Toll free within Canada) or 866-541-4104 (Toll free within Canada & USA) (IFR only) Moncton 506-867-7177 or 866-480-8200. METAR H24. TAF H24, issue times: 00, 03, 06, 09, 12, 15, 18, 21Z WxCam

CANADA FLIGHT SUPPLEMENT / GPH 205

Effective 0901Z 12 August 2021 to 0901Z 7 October 2021

B432 AERODROME/FACILITY DIRECTORY

HALIFAX / STANFIELD INTL NS (Cont'd)

CYHZ

SERVICES	
FUEL	100LL, JA-1 (FSII avbl)
OIL	All
S	1,2,3
ARFF	DESIGNATED CAT 8
SUP FL	ADI, D & A-ice
JASU	Elect Start Stewart-Stevenson 2650 Air Start
PVT ADV	Shell Aerocentre 123.4; PAL Aviation Services 129.3; Gateway Fac ULC 129.1 902-873-1900
MIL CON	Innotech Aviation Services (Shell) 902-873-3737
RWY DATA	Rwy 05(053°)/23(233°) 10500x200 ASPH/CONC Thld 23 displ 361' Rwy 14(143°)/32(323°) 7700x200 ASPH Rwy 32 down 0.54% RESA: All Rwy 492'
RWY CERT	Rwy 05 RVR 1200(1/4sm)/Rwy 23 RVR 600 AGN V Rwy 14 RVR 1200(1/4sm)/Rwy 32 RVR 1200(1/4sm) AGN V
RCR	Opr CRFI, PLR/PCN
LIGHTING	05-AN(TE HI CL) P3, 14-AN(TE HI), 23-AL(TE HI CL TDZL), 32-AN(TE HI) P3
COMM	
RCO	London rdo 123.275 (FISE) 126.7 (bcst) (E) (emerg only 902-873-3227)
ATIS	121.0
CLNC DEL	123.95
GND	121.9 275.8
TWR	118.4 236.6 (E) (emerg only 902-873-1364)
TML	119.2 118.7 128.55 363.8
PAL	Moncton Ctr 135.3
NAV	
VOR/DME	YHZ 115.1 Ch 98 N44 55 23 W63 24 07 (604')
DME	IHZ 109.1 Ch 28 N44 53 35 W63 30 48 (449')
ILS	IJG 109.9 (Rwy 23) RVR LOC reliable only within 10° either side of centreline; IHZ 109.1 (Rwy 14) RVR LOC reliable only within 10° either side of centreline.
LOC	IGX 109.9 (Rwy 05) LOC reliable only within 10° either side of centreline.
PRO	In vis RVR 2600 (1/2 SM) or greater, Rwy 23 dep will be fr Twy E (9100 FT) unless otherwise requested. Pilots should refer to Canadian Airport Charts (CAC) to obtain details on established hot spots, prior to operating on maneuvering areas. CAC are available for free on the NAV CANADA website. DE-ICING OPERATIONS 1. Ctc de-icing provider 30 min prior to dep if de-icing is rqrd. Notify de-icing provider of any special treatments prior to pushback: ICE MAN 122.950 or 902-410-7748. 2. De-icing provider will assign de-ice pad and advise when ready. 3. DO NOT PUSH prior to assigned de-ice pad being ready. 4. To mitigate congestion on the APN, QUEUEING for de-icing is NOT ACCEPTABLE. 5. Monitor Halifax GND 121.9 for all APN movement. 6. Follow instructions to designated de-ice pad. 7. Advise ICEMAN immediately once brakes set, acft configured and engines at idle. 8. After de-icing, configure acft for taxi, however, DO NOT MOVE ACFT. 9. Once instructed, ctc Halifax GND 121.9 for taxi.
CAUTION	Extensive bird activity in vic of rwys Oct-Mar.