


CANADA FLIGHT SUPPLEMENT / GPH 205

Effective 0901Z 12 August 2021 to 0901Z 7 October 2021

B854 AERODROME/FACILITY DIRECTORY

PRINCE GEORGE BC

CYXS

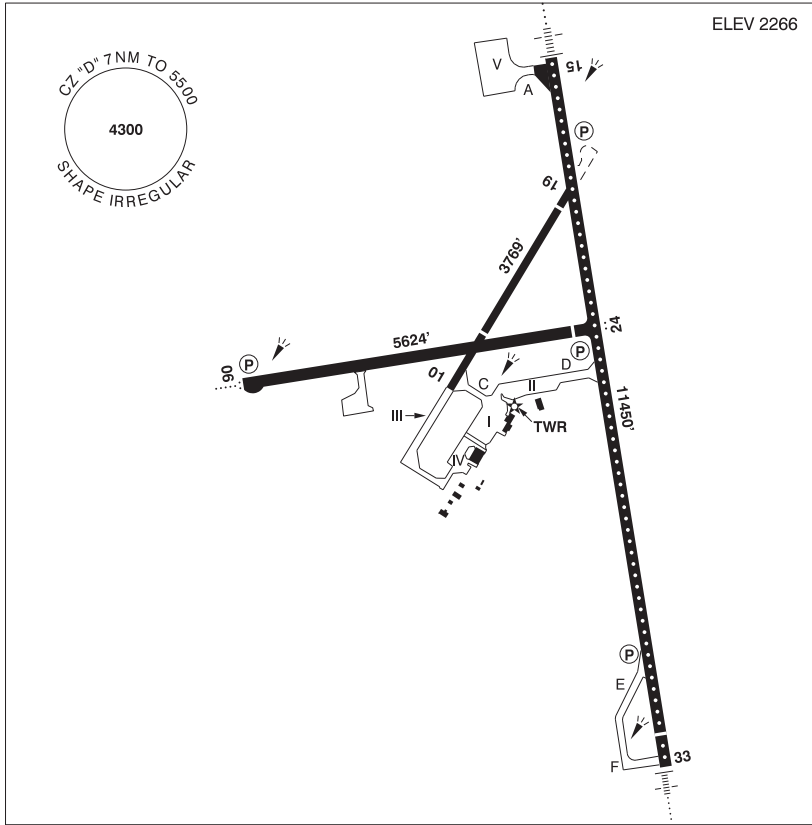

REF	N53 53 03 W122 40 39 2.8SE 18°E (2014) UTC-8(7) Elev 2266' A5014 LO1 HI3 CAP
OPR	Prince George Airport Authority 250-963-2400 Cert
PF	A-1,2,3,6 C-4,5
CUST	AOE/30 (120 with staged off-loading) 888-226-7277 1630-0030Z‡
FLT PLN	<p>FIG Kamloops 866-WXBRIEF (Toll free within Canada) or 866-541-4101 (Toll free within Canada & USA)</p> <p>WX METAR AUTO H24 (see COMM). TAF H24, issue times: 01, 07, 13, 19Z. WxCam</p>
SERVICES	<p>FUEL 100LL, JA-1 (FSII avbl), F-34, JB, HPR</p> <p>OIL All</p> <p>S 1,2,3,4</p> <p>ARFF DESIGNATED CAT 7 1400-0730Z‡, O/T call out chg, 2 hr PN, aprt clsd to acct 20 seats & abv, exc for diversions or as an altn A/D without PPR.</p> <p>PVT ADV Esso 122.85 250-963-7911, Jetmark 129.4 250-963-7345</p> <p>MIL CON Executive Flight Centre Fuel 250-963-7354</p>

CANADA FLIGHT SUPPLEMENT / GPH 205

Effective 0901Z 12 August 2021 to 0901Z 7 October 2021

AERODROME/FACILITY DIRECTORY B855

PRINCE GEORGE BC (Cont'd)

CYXS

RWY DATA	Rwy 15(153°)/33(333°) 11450x150 asphalt Thld 33 displ 500' Rwy 15 down 0.3% Rwy 06(063°)/24(243°) 5624x150 asphalt Thld 24 displ 401' Rwy 24 up 0.87% Rwy 01(013°)/19(193°) 3769x75 asphalt Thld 01 displ 984' Thld 19 displ 373'
RWY CERT	Rwy 15 RVR 1200(1/4sm)/Rwy 33 RVR 1200(1/4sm) AGN V Rwy 06/24 AGN IIIB Rwy 01/19 AGN II
TWY CERT	Twy: C, D AGN IV
RCR	Opr 1300-0730Z±. Rwy 01/19 rstd to 12,500 lbs for ldg & tkof day only. Win maint 1300-0730Z± O/T 2hr PN cost recovery. CRFI, PLR/PCN.
LIGHTING	06-AO(TE ME) P2, 24-AS(TE ME) P2, 15-AN(TE HI CL) P3, 33-AN (TE HI CL) P2 PAPI limitation/restriction. PAPI Rwy 24 to be used only within 5NM of thld ARCAL-118.3 type K when twr clsd Rwys 01/19 lit as twy
COMM	
RCO	Williams Lake rdo 118.3 (RAAS) 07-14Z± Pacific rdo 123.55 (FISE) 126.7 (bcst)
ATIS	128.725 14-07Z±
GND	121.9 14-07Z±
TWR	118.3 (V) 14 -07Z± (emerg only 250-963-9177)
MF	Williams Lake rdo 118.3 07-14Z± CZ shape irregular 7NM 5500 ASL (CAR 602.98) (emerg only 250-989-4415)
PAL	Vancouver Ctr 133.8
AWOS	128.725 07-14Z±
NAV	
NDB	XS 272 (M) N53 49 42 W122 39 15 NORTHWOOD ZXS 260 (L) N53 58 03 W122 41 24
VOR/DME	YXS 112.3 Ch 70 N53 53 39 W122 27 20 (4076') Scalping may be experienced on all radials from 20-60NM
ILS	IXS 109.5 (Rwy 15) RVR LOC reliable only within 10° either side of centreline.
PRO	Rgt hand circuits Rwys 19, 24 & 33 (CAR 602.96).
CAUTION	Tall vehicles crossing 910' N thld Rwy 15. Extv bird activity dur spring & fall. Parajumping activity vic Beaverley A/D 8NM SW to 12,500 ASL by NOTAM, monitor 122.1. Radiosonde balloon launches with an ascent rate of 1000 ft/min daily between the hours of 1115-1345Z & 2315-0145Z. Hi terrain reduces operational length of Rwy 24 PAPI.