


MONCTON / GREATER MONCTON ROMÉO LEBLANC INTL NB

CYQM

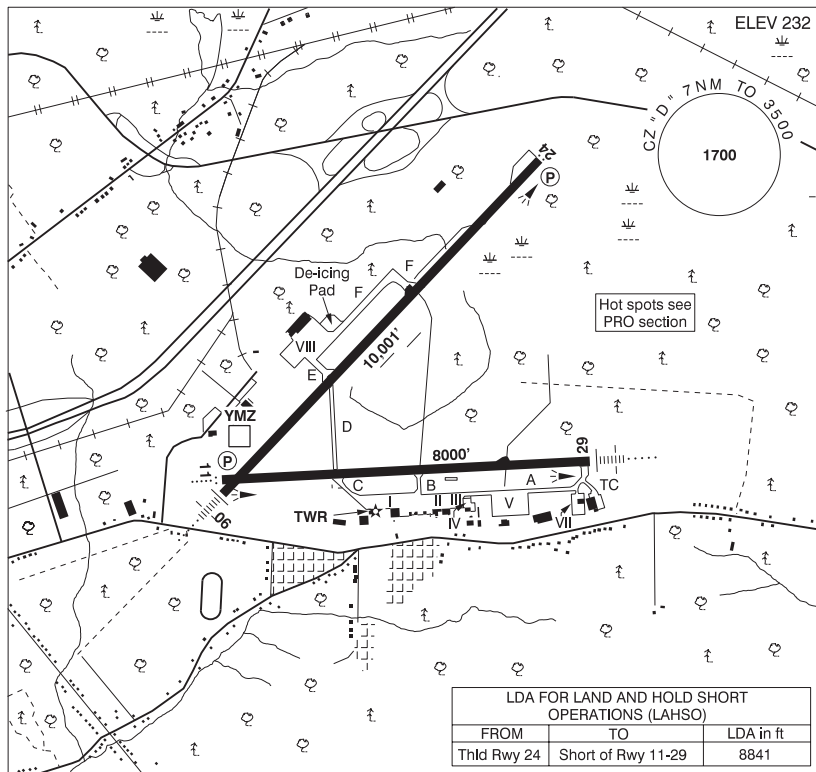

REF	N46 06 58 W64 40 43 4ENE 18°W (2013) UTC-4(3) Elev 232' A5003 LO8 HI6 T2 CAP OC
OPR	Greater Moncton International Airport Authority Inc 506-856-5444 0845-0415± O/T 2 hr PN call out charge Cert
PF	A-1,2,6 C-3,4,5
CUST	AOE/300 888-226-7277 12-04Z±
FLT PLN	
FIC	London 866-WXBRIEF (Toll free within Canada) or 866-541-4104 (Toll free within Canada & USA)
ACC	(IFR only) Moncton 506-867-7177 or 866-480-8200.
WX	METAR H24 TAF H24, issue times: 00, 06, 12, 18Z

NEW BRUNSWICK

AERODROME / FACILITY DIRECTORY

MONCTON / GREATER MONCTON ROMÉO LEBLANC INTL NB (Cont'd) CYQM

SERVICES	Call out chg may be levied for one or more svcs.
FUEL	100LL, JA-1 (FSII avbl) PN ASIG 506-857-9140
OIL	All
S	1,2
ARFF	DESIGNATED CAT 6 (CAT 7 2 hr PN) 0845-0415‡ O/T 2 hr PN call out chg.
SUP FL	O & D-ice
JASU	(Hobart 1400 amp 30-40 volts), Elect Start 10/25, GTC/GTE-85 & NC-10A/A1/B/C
PVT ADV	Shell Aerocentre 122.15, ATS 131.75 Moncton Flight College 123.5 (Ltd hrs) Air Canada gnd hldg 130.37 506-857-1065 Skylink Express 131.37, ltd hangarage avbl
MIL CON	ASIG Canada 506-857-9140
RWY DATA	Rwy 06(061°)/24(241°) 10,001x200 ASPH Rwy 11(106°)/29(286°) 8000x200 ASPH RESA: All Rwy 492'
RWY CERT	Rwy 06 RVR 1200(1/4sm)/Rwy 24 RVR 1200(1/4sm) AGN V Rwy 11 RVR 1200(1/4sm)/Rwy 29 RVR 1200(1/4sm) AGN V
TWY CERT	Twy: A, B, C, D AGN IV
APRON	Acft manoeuvring on apron VIII must maintain a listening watch & are to broadcast their movement intentions on Apron VIII Advisory 122.075. Itinerant acft wishing to use Apron VIII ctc Airport Security 506-856-5429 - 2 hr PN. Apron IV (Moncton Flight College) restricted to acft 8,000 lbs or less.
RCR	Opr 506-850-8430 11-19Z‡ Mon-Fri exc hols O/T 2 hrs PN, call out charge. CRFI/RSC, PCN
LIGHTING	06-AN(TE HI), 24-AS(TE HI) P3 3.1°, 11-AO(TE HI) P3 3.1°, 29-AN(TE HI)
COMM	
RCO	London rdo 122.5 (FISE) 126.7 (bcst)
ATIS	128.65
APRON ADV	Apron VIII 122.075
GND	121.8 275.8
TWR	120.8 236.6 (E) (emerg only 506-867-7220)
ARR	124.4
DEP	124.4
PAL	124.4 127.125 132.2
NAV	
DME	YMZ 117.0 Ch 117 N46 06 33 W64 41 33 (233')
ILS	IQM 109.3 (Rwy 29) RVR IFG 109.7 (Rwy 06) RVR
PRO	De-icing apron VIII - Prior to pushback, broadcast intentions & monitor all movements on Apron Advisory 122.075. Proceed to de-icing pad. Pilots should refer to Canadian Airport Charts (CAC) to obtain details on established hot spots, prior to operating on maneuvering areas. CAC are available for free on the NAV CANADA website.
CAUTION	Training areas around CZ, see Moncton VTPC - Training areas.