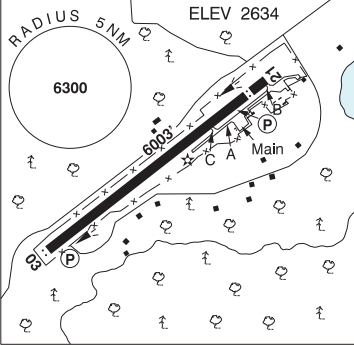


BRITISH COLUMBIA

AERODROME / FACILITY DIRECTORY

DEASE LAKE BC

CYDL

REF	N58 25 20 W130 01 53 1.5S 19°E (2020) UTC-8(7) Elev 2634' A5021 LO5 HI2 RCAP	
OPR	Stikine Airport Society 778-210-5727, 250-617-1482 Reg	
PF	B-1 C-2,4,5	
FLT PLN	FICKamloops 866-WXBRIEF (Toll free within Canada) or 866-541-4101 (Toll free within Canada & USA) ACCEdmonton IFR 888-358-7526 WXMETAR AUTO H24 (see COMM) TAF 13-00Z†, issue times: 13, 19Z (DT 12, 18Z) WxCam	
SERVICES		
FUELS	100LL, JA-1 (FSII avbl) 250-617-1482, 250-771-5911 16-02Z† O/T call out chg 4,6	
RWY DATA	Rwy 03(033°)/21(213°) 6003x100 asphalt Thld 21 displ 402'. First 1600' Rwy 03 up 1.5%	
APRON	Apron Main: Parking available only at the Main apron with plug-in facilities	
RCR	TNDC 250-617-1482, 250-771-5911	
LIGHTING	03-AS(TE ME) P2 4°, 21-AS(TE ME) P2 4° ARCAL-123.2 type K exc RILS on high setting only. Ngt ops are not recommended unless all 3 hazard bcns are oprg.	
COMM	RCOWhitehorse rdo 123.475 (FISE) 126.7 (bcst) ATFtfc 123.2 5NM 5600 ASL AWOS128.7	
NAV	NDBYDL 200 (M) N58 27 14 W129 59 46	
PRO	Rgt hand circuits Rwy 03 (CAR 602.96). Ngt circuits 3800 ASL (1200 AGL). Ngt circuit pro depicted on VTPC.	
CAUTION	Only pilots familiar with lcl terrain should use this aprt dur hrs of darkness.	