


BRITISH COLUMBIA

AERODROME / FACILITY DIRECTORY

PRINCE GEORGE BC

CYXS

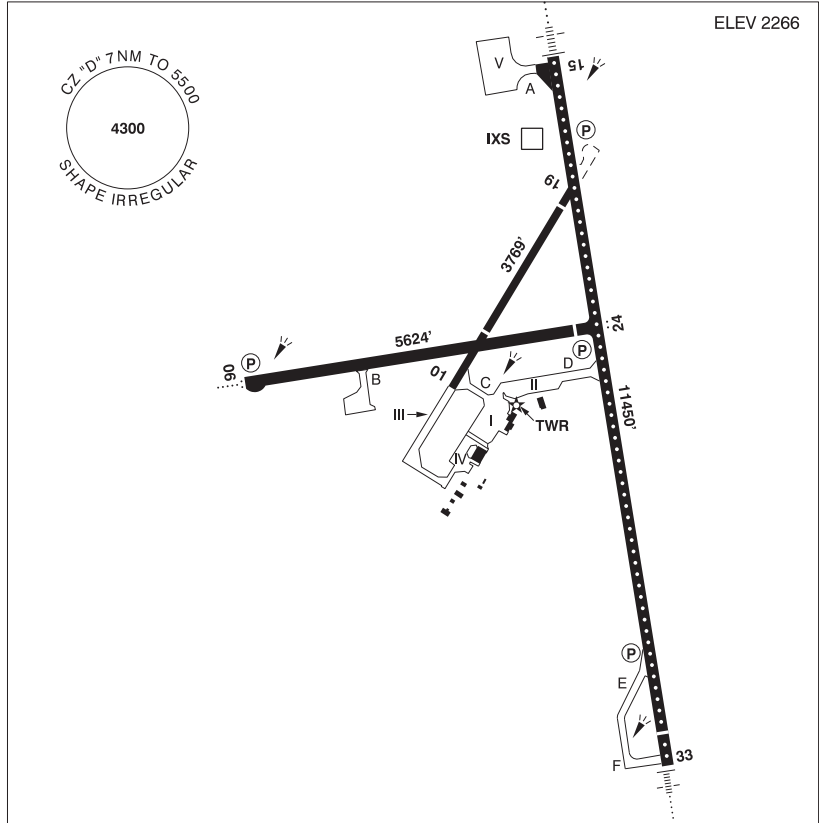

REF	N53 53 03 W122 40 39 2.8SE 18°E (2014) UTC-8(7) Elev 2266' A5014 LO1 HI3 CAP
OPR	Prince George Airport Authority 250-963-2400 Cert
PF	A-1,2,3,6 C-4,5
CUST	AOE/30 (120 with staged off-loading) 888-226-7277 1630-0030Z±
FLT PLN	
FIC	Kamloops 866-WXBRIEF (Toll free within Canada) or 866-541-4101 (Toll free within Canada & USA)
WX	METAR AUTO H24 (see COMM). TAF H24, issue times: 01, 07, 13, 19Z. WxCam
SERVICES	
FUEL	100LL, JA-1 (FSII avbl), F-34, JB, HPR
OIL	All
S	1,2,3,4
ARFF	DESIGNATED CAT 7 1400-0730Z± sked pax flt only, O/T call out chg, 2 hr PN, aprt clsd to acft 20 seats & abv, exc for diversions or as an altn A/D without PPR.
PVT ADV	Jetmark 129.4 250-961-8124
MIL CON	PetroValue Products Canada Inc. 604-576-0004

BRITISH COLUMBIA

AERODROME / FACILITY DIRECTORY

PRINCE GEORGE BC (Cont'd) CYXS

RWY DATA	Rwy 15(153°)/33(333°) 11450x150 ASPH Thld 33 displ 500' Rwy 15 down 0.3% Rwy 06(063°)/24(243°) 5624x150 ASPH Thld 24 displ 401' Rwy 24 up 0.87% Rwy 01(013°)/19(193°) 3769x75 ASPH Thld 01 displ 984' Thld 19 displ 373'
RWY CERT	Rwy 15 RVR 1200(1/4sm)/Rwy 33 RVR 1200(1/4sm) AGN V Rwy 06/24 AGN IIIB Rwy 01/19 AGN II
TWY CERT	Twy: B AGN IIIB Twy: C, D AGN IV
RCR	Opr 1300-0730Z†. Rwy 01/19 rstd to 12,500 lbs for ldg & tkof day only. Win maint 1300-0730Z† O/T 2hr PN cost recovery. CRFI, PLR/PCN.
LIGHTING	06-AO(TE ME) P2, 24-AS(TE ME) P2, 15-AN(TE HI CL) P3, 33-AN(TE HI CL) P2 PAPI limitation/restriction. PAPI Rwy 24 to be used only within 5NM of thld ARCAL-118.3 type K when twr clsd Rwy 01/19 lit as twy
COMM	RCO Williams Lake rdo 118.3 (RAAS) 07-14Z† Pacific rdo 123.55 (FISE) 126.7 (bcst) ATIS 128.725 14-07Z† GND 121.9 14-07Z† TWR 118.3 (V) 14 -07Z† (emerg only 250-963-9177) MF Williams Lake rdo 118.3 07-14Z† CZ shape irregular 7NM 5500 ASL (CAR 602.98) (emerg only 250-989-4415) PAL Vancouver Ctr 133.8 AWOS 128.725 07-14Z†
NAV	VOR/DME YXS 112.3 Ch 70 N53 53 39 W122 27 20 (4076') DME IXS 109.5 Ch 32 N53 53 46 W122 40 19 (2260') ILS IXS 109.5 (Rwy 15) RVR LOC reliable only within 10° either side of centreline.
PRO	Rgt hand circuits Rwy 19, 24 & 33 (CAR 602.96).
CAUTION	Tall vehicles crossing 910' N thld Rwy 15. Extv bird activity dur spring & fall. Parajumping activity vic Beaverley A/D 8NM SW to 12,500 ASL by NOTAM, monitor 122.1. Radiosonde balloon launches with an ascent rate of 1000 ft/min daily between the hours of 1115-1345Z & 2315-0145Z. Hi terrain reduces operational length of Rwy 24 PAPI.