

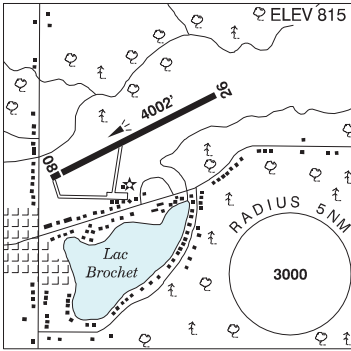
## CANADA FLIGHT SUPPLEMENT / GPH 205

Effective 0901Z 12 August 2021 to 0901Z 7 October 2021

### B660 AERODROME/FACILITY DIRECTORY

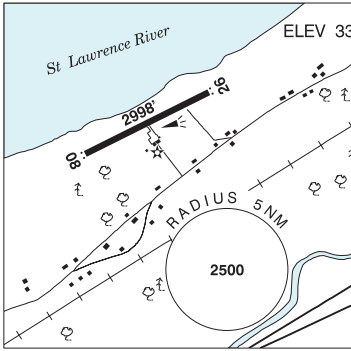
#### MONT-LAURIER QC

**CSD4**

<b>REF</b>	N46 33 53 W75 34 34 3W 14°W (2013) UTC-5(4) Elev 815' A5000 A5002 LO6 LO7 CAP	
<b>OPR</b>	A.P.P.A. 819-623-5475 Reg	
<b>PF</b>	A-1,2 12-02Z± Mon-Sat 13-03Z± Sun C-3,4,5,6	
<b>FLT PLN</b>	(bil) <b>FIG</b> Québec 866-GOMÉTÉO or 866-WXBRIEF (Toll free within Canada) or 866-541-4105 (Toll free within Canada & USA) <b>ACC</b> Montréal 800-633-1353 <b>WX</b> AUTO (see COMM) WxCam	
<b>SERVICES</b>	13-22Z± O/T 819-623-5475	
<b>FUEL</b>	100LL, JA	
<b>OIL</b>	15W30	
<b>S</b>	1,2,4,5,6	
<b>RWY DATA</b>	Rwy 08(077°)/26(257°) 4002x75 asphalt Thld 08 displ 197'	
<b>RCR</b>	Opr Expect delays for snow removal.	
<b>LIGHTING</b>	08-(TE ME), 26-(TE ME) (no setting to ME) ARCAL-122.8 type J	
<b>COMM</b>		
<b>RCO</b>	(bil) Québec rdo (Mont-Laurier) 123.475 (FISE)	
<b>ATF</b>	UNICOM ltd hrs O/T tfc 122.8 5NM 3900 ASL	
<b>PAL</b>	(bil) Montréal Ctr 126.575	
<b>AUTO</b>	129.075 (English) 123.425 (French)	
<b>NAV</b>		
<b>NDB</b>	2Q 373 (L) N46 36 09 W75 28 14 Pvt	
<b>CAUTION</b>	Possibility of deer on rwy.	

#### MONTMAGNY QC

**CSE5**

<b>REF</b>	N47 00 07 W70 30 57 1.7NE 17°W (2013) UTC-5(4) Elev 33' A5002 LO7 LO8	
<b>OPR</b>	Transports Québec 418-248-7423 or 418-931-9317 Cert	
<b>PF</b>	A-1 B-1 C-2,3,4,5,6	
<b>FLT PLN</b>	(bil) <b>FIG</b> Québec 866-GOMÉTÉO or 866-WXBRIEF (Toll free within Canada) or 866-541-4105 (Toll free within Canada & USA)	
<b>SERVICES</b>	Air Montmagny 418-248-3545 13-20Z± Mon-Fri O/T 1 hr PN call out chg	
<b>FUEL</b>	100LL	
<b>S</b>	1,4,5,6	
<b>RWY DATA</b>	Rwy 08(076°)/26(256°) 2998x75 ASPH	
<b>RWY CERT</b>	Rwy 08/26 AGN I	
<b>RCR</b>	Opr 12-22Z± CRFL (avbl winter only) PLR/PCN	
<b>LIGHTING</b>	08-AS(TE ME), 26-AS(TE ME) ARCAL-122.7 type K	