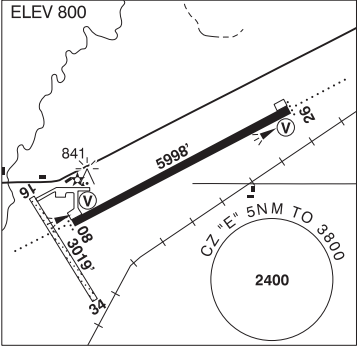


ONTARIO

AERODROME / FACILITY DIRECTORY

EARLTON (TIMISKAMING REGIONAL) ON

CYXR

REF	N47 41 42 W79 50 56 1SW 12°W UTC-5(4) Elev 800' A5001 LO4 LO7 HI4 HI5 CAP	
OPR	Earlton-Timiskaming Regional Airport Authority 705-563-2215 Reg 1200-2030Z± Mon-Fri exc hols	
PF	B-1 C-2,4, D-3,5,6	
FLT PLN		
FIC	London 866-WXBRIEF (Toll free within Canada) or 866-541-4104 (Toll free within Canada & USA)	
WX	METAR AUTO H24 (see COMM) TAF 13-01Z±, issue times: 13, 18Z (DT 12, 18Z). WxCam	
SERVICES		
FUEL	100LL, JA-1 1200-2030Z± Mon-Fri exc hols, O/T Cardlock (VISA/Mastercard)	
OIL	100, 15W50	
RWY DATA	Rwy 08(075°)/26(255°) 5998x150 ASPH AGN IIIA Rwy 16(160°)/34(340°) 3019x150 GRVL Rwy 34 up 0.86% AGN I	
RCR	London FIC AMSCR/CRFI 1100-2030Z± Mon-Fri exc hol Nov 7-Apr 17 O/T 3hr PN call out charge may be levied ctc opr. PCN Rwy 16/34 No win maint Soft in spring & fall	
LIGHTING	08-AD(TE ME) V2, 16-(TE ME), 26-AD AS(TE ME) V2, 34-(TE ME) ARCAL-122.0 type K. RILS activated by ARCAL on high ints setting only. Rwy16/34 not avbl Nov 7-Apr 16.	
COMM		
RCO	London rdo 123.375 (FISE)	
MF	tfc 122.0 5NM 3800 ASL (CAR 602.98)	
AWOS	128.6	
PRO	Rgt hand circuits Rwy 08 (CAR 602.96).	