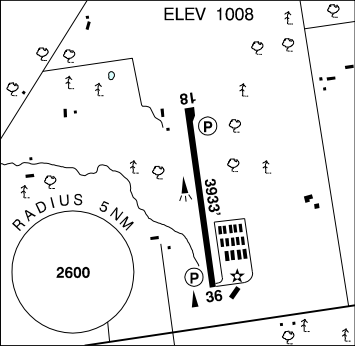


ONTARIO

AERODROME / FACILITY DIRECTORY

OWEN SOUND / BILLY BISHOP REGIONAL ON

CYOS

REF	N44 35 26 W80 50 18 3E 10°W UTC-5(4) Elev 1008' A5000 LO4 LO6 CAP	
OPR	Owen Sound Regional Airport Inc. 519-371-6936 Reg Ldg fees	
PF	A-1,2,7 C-3,4,5,6	
CUST	AOE/15 888-226-7277 13-21Z± Mon-Fri exc hols	
FLT PLN		
FIC	London 866-WXBRIEF (Toll free within Canada) or 866-541-4104 (Toll free within Canada & USA)	
SERVICES	12-21Z± Oct 1-Apr 30, 13-22Z± May 1-Sep 30 O/T call out chg 2 hrs PN	
FUEL	100LL, JA-1, SP	
OIL	Aeroshell 15W50, W80, W100	
S	2,4,5	
RWY DATA	Rwy 18(181°)/36(001°) 3933x75 ASPH Rwy 18, first 1849' 1.0% down, last 2083' 0.9% up AGN I	
RCR	Opr	
LIGHTING	18-(TE LO) AP, 36-(TE LO) AP ARCAL-123.0 type J	
COMM		
ATF	UNICOM (AU) ltd hrs O/T tfc 123.0 5NM 4000 ASL	
PRO	Rgt hand circuits Rwy 36 (CAR 602.96).	
CAUTION	331' twr 1.2NM W of rwy. Wildlife frequently on rwy.	