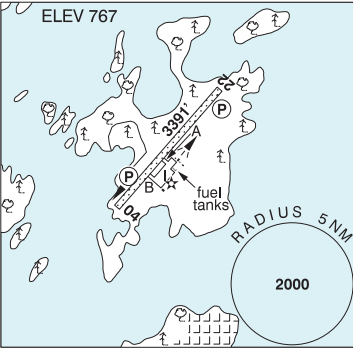


MANITOBA

AERODROME / FACILITY DIRECTORY

ST. THERESA POINT MB

CYST

REF	N53 50 44 W94 51 08 0.8N 0° (2018) UTC-6(5) Elev 767' A5017 LO3 CAP	
OPR	Govt of Manitoba 204-945-3421 13-18Z±, 19-22Z± Mon-Fri exc hols O/T MEDEVAC only 1 hr PN 204-980-0152 Cert	
PF	A-1 C-4 Tml bldg opr 13-18Z±, 19-22Z± Mon-Fri, clsd Sat, Sun & hols	
FLT PLN	Pilots to open/close VFR flt plan with Edmonton rdo, FISE or by phone.	
FIC	Edmonton 866-WXBRIEF (Toll free within Canada) or 866-541-4102 (Toll free within Canada & USA) (see PRO)	
RWY DATA	Rwy 04(041°)/22(221°) 3391x75 crushed rock Rwy 04 up 0.34% first 2357'	
RWY CERT	Rwy 04/22 AGN II	
APRON	Apron I: Ltd win maint	
RCR	APM 204-462-2084 13-18Z±, 19-22Z± Mon-Fri exc hols O/T 204-462-2398 MEDEVAC only 1 hr PN 204-980-0152.	
LIGHTING	04-(TE ME) P1, 22-(TE ME) P1 ARCAL-122.2 type K (see CAUTION)	
COMM		
RCO	Thunder Bay rdo (Island Lake) 122.2 (RAAS) Edmonton rdo (Island Lake) 122.375 (FISE) 126.7 (bcst)	
MF	Thunder Bay rdo 122.2 5NM 3800 ASL (CAR 602.98)	
NAV		
NDB	ISLAND LAKE YIV 300 (M) N53 51 14 W094 39 12	
CAUTION	Extv low lvl heli tfc within MF area dur break-up & freeze-up. See ISLAND LAKE - ST.THERESA POINT VTPC. Possible unreported tfc or vehicles on rwy due to rdo blind spot. Island Lake A/D, MF 122.2, 7NM E. Three twr hydro cable span centred on N53 54 09 W94 42 49 (6NM NE aprt) 200 AGL 979 ASL, red & white markers on span. Rwy edge lgt installed higher than std (aprx 27 inches high loc 5' outside rwy edge). Extv bird activity Apr-Oct. Graded Areas: Graded areas around rwy for aprt maint vehicle only.	