


ILS Z RWY 08 (DND)

531909N 0602533W VAR 19°W

ATIS - 128.1 340.8	TML - 119.5 267.1 CTR Gander - 120.4 267.1	TWR - 124.5 236.6	GND - 132.0 275.8	
SAFE ALT 100 NM 6000	LOC IYR 110.3	APCH CRS 075°	GP FAFKO 2860	LDA 11052

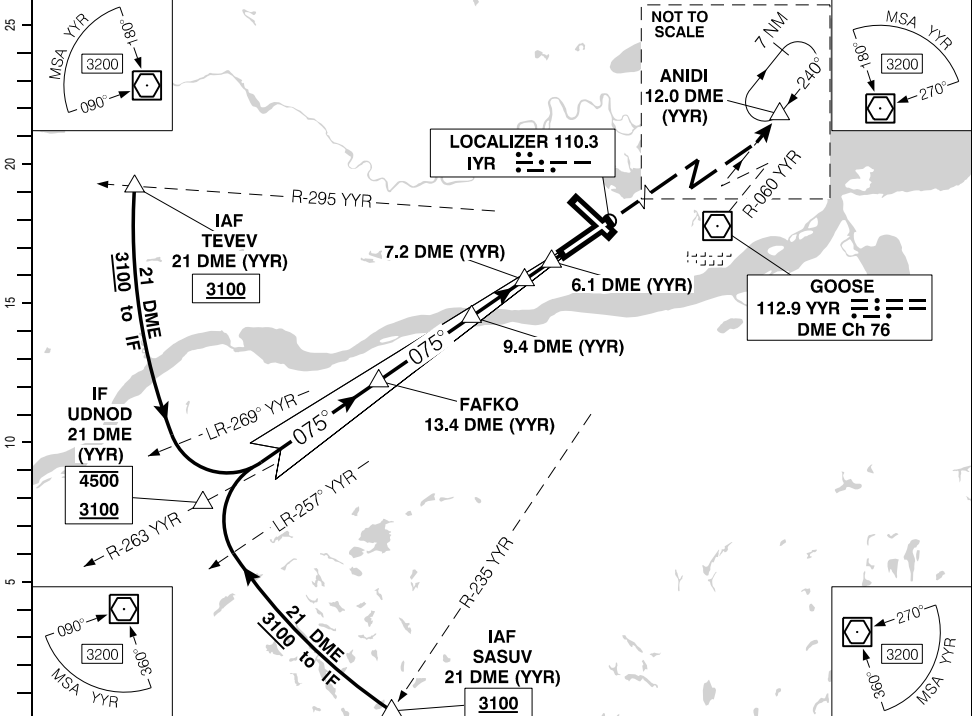

	16	15	14.3	13	12	11	10	9	8	7	6.4	DIST FROM DME (YYR)
	3630	3320	3100	2680	2360	2040	1720	1400	1090	770	580	ALT (3.00° APCH PATH)
UDNOD 21 DME (YYR)	3100	FAFKO GP 2860	MISSED APPROACH Climb 3200 hdg 075° to intercept R-060 (YYR) out to ANIDI (12 DME) and hold.									
Procedure turn NOT AUTHORIZED			GP 3.00°									
2100			9.4 DME (YYR)									
1400 (LOC Only)			075°									
7.7			7.2 DME (YYR)									
4.1			6.1 DME (YYR)									
2.3			MDA									
1.2			TCH 57'									
0.6			ELEV 160 TDZE 160									

			CATEGORY	A	B	C	D
			ILS/DME	360	(200)	1/2 RVR 26	
			LOC/DME	580	(420)	1 RVR 50	
Knots	ft/min	Min:Sec					
70	370						
90	480						
110	580						
130	690						
150	800						

ILS Z RWY 08 (DND)

CYYR

EFF 9 JUL 26

Source of Canadian Civil Aeronautical Data: © 2026 NAV CANADA All rights reserved